
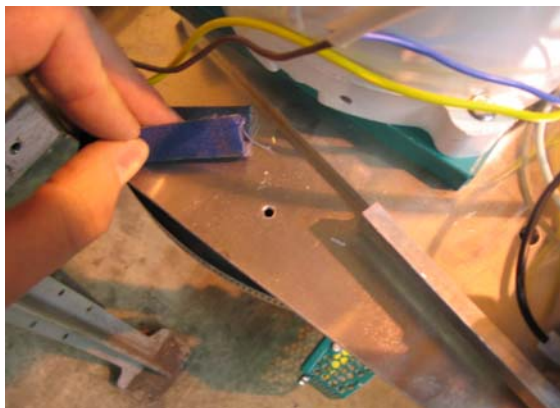


J&J Service Instructions

January 5, 2005

Solid State Relay Installation

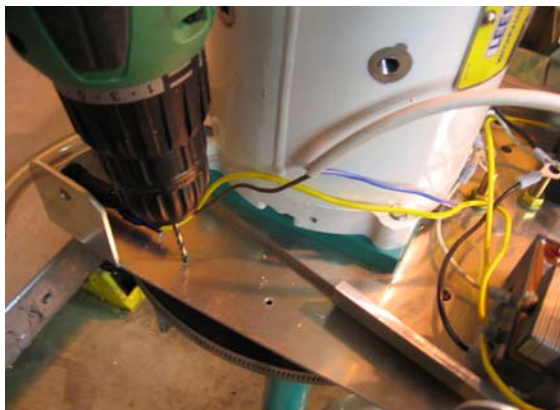

- Remove old relay
- The SSR will be mounted on the left side of hood mount.
- Temporarily position relay and mark where the mount holes need to be drilled.
- Drill holes using a 1/8 inch bit.
- Prep surface where holes were drill.
- Surface should be smooth and the holes should have no flashings protruding .

J&J Service Instructions

May 27, 2004


Solid State Relay Installation




- Apply a thin amount of di-electric grease to bottom side of SSR. This will help to transfer heat to hood mount and keep the SSR cool.



- Crimp the supplied ring terminal to the yellow load wire from the go switch.

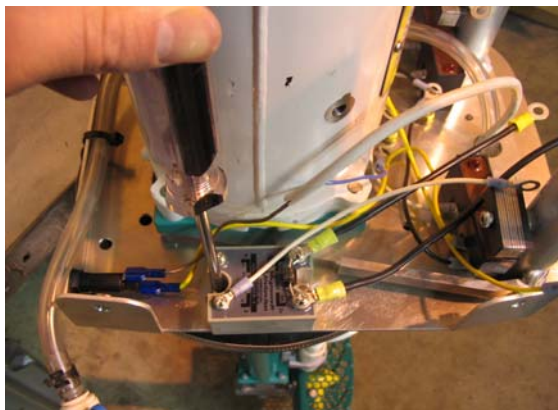

- Mount the SSR with the supplied 5/32 screws.

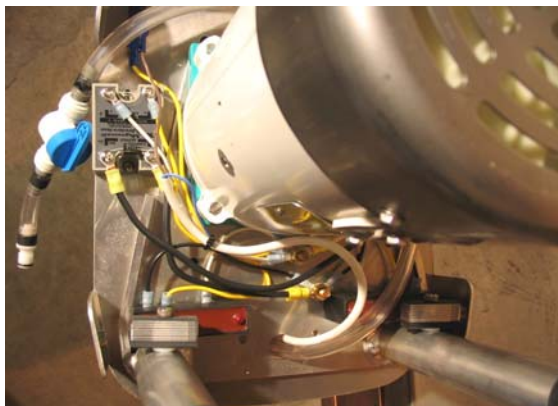

- Connect leads from SSR to motor assy..
 - **SSR Post 1** to negative power post
 - **SSR Post 2** to negative lead from motor
 - **SSR Post 3** to positive power post
 - **SSR Post 4** to yellow load wire from go switch
- A zip may be used to bundle wires together and keep them from interfering with the switches.