


# SERVICE BULLETIN

AUGUST 95

KART-0006

## FLY BY WIRE (KART REMOTE SYSTEM)

**SOME CUSTOMERS ARE REPORTING THAT THE SPEED ADJUSTMENT CAN BE SOMEWHAT ERRATIC. THIS IS CAUSED BY THE ENCODER PUTTING OUT TOO MANY PULSES. IT IS ONLY NOTICEABLE ON A FEW KARTS, BUT CAN BE SOLVED BY PUTTING A 47 ohm 1/4 w RESISTOR ACROSS THE ENCODER. RESISTORS WILL BE INCLUDED WITH THIS**

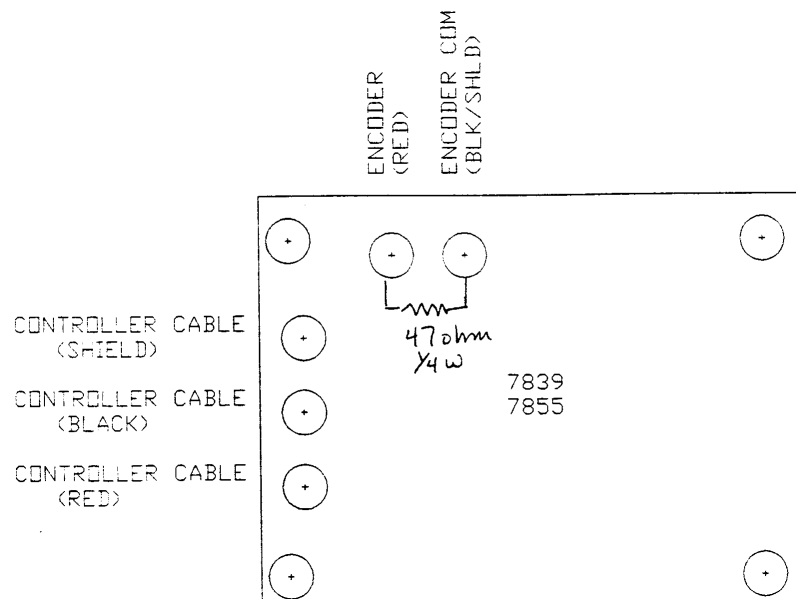

If you have any questions please call service at (800) 854-3140 or (503) 363-