

SERVICE BULLETIN

OCTOBER 23 1997

PRODUCT UPDATE: FUEL TANK, HEAT SHIELD

MODELS INVOLVED

All 5.5/6.5 HP go-karts equipped with Muffler Deflector Comps. (This problem has only occurred on these models, however all units with extra capacity fuel tanks installed should be inspected for this condition [A]).

SYMPTOM

The fuel tank area at rear of muffler becomes soft and/or develops a leak.

PROBABLE CAUSE

The muffler deflector may restrict exhaust flow from muffler causing excess heat which can distort fuel tank and in extreme cases contact muffler. If this should occur, fuel tank can become soft and could result in a rupture [A].

CORRECTIVE ACTION

Install Heat Shield immediately [B].

Fuel Tank, Heat Shield: **Part#00111**

Shields will be sent UPS ground at no charge.

UPDATE TO THE OCTOBER 24 1995 BULLETIN

SYMPTOM

Muffler guard cracking from engine vibration.

CORRECTIVE ACTION

Install Flat Bushing Part# 009071 Qty [1] immediately [C].




00877 - Bolt, 1/4-20x1 Qty[1]

00948 - Nut, 1/4-20 z Qty [1]

00966 - Washer, 1/4-z Flat Qty [1]

Fuel Tank, Heat Shield: **Part#00111**

NOTE: There is a 90 day warranty on all parts.

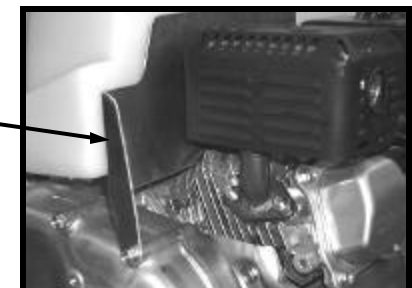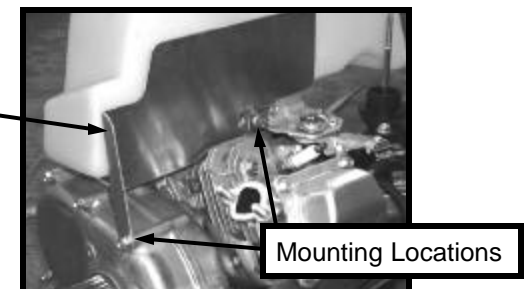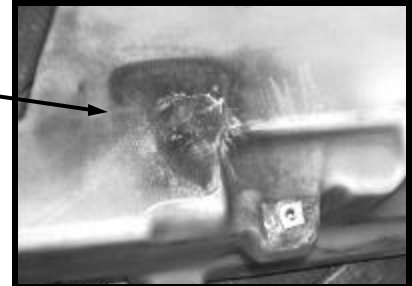

Any questions call (800) 854-3140 or (503) 304-