

SERVICE BULLETIN

OCTOBER 24 1995

PRODUCT UPDATE: FUEL TANK, HEAT SHIELD

MODELS INVOLVED

All 5.5 HP go-karts equipped with Muffler Deflector Comps. (This problem has only occurred on these models, however all units with extra capacity fuel tanks installed should be inspected for this condition [A]).

SYMPTOM

The fuel tank area at rear of muffler becomes soft and/or develops a leak.

PROBABLE CAUSE




The muffler deflector may restrict exhaust flow from muffler causing excess heat which can distort fuel tank and in extreme cases contact muffler. If this should occur, fuel tank can become soft and could result in a rupture [A].

CORRECTIVE ACTION

Install Heat Shield immediately [B].

Fuel Tank, Heat Shield: **Part#00111**

Shields will be sent UPS ground at no charge.

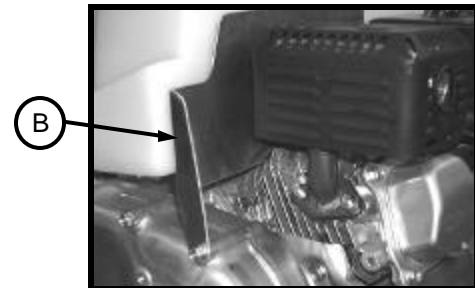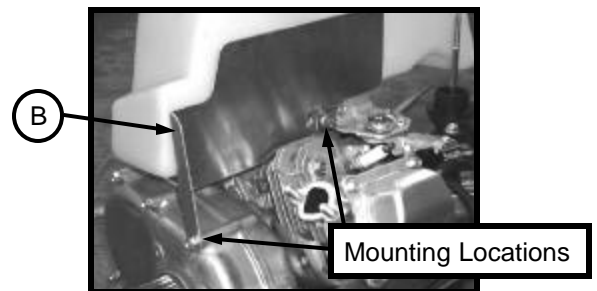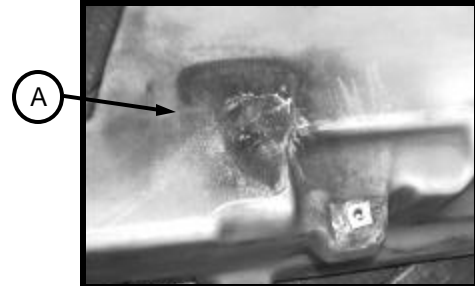

Any questions call (800) 854-3140 or (503) 363-



2315 Pringle Road SE
Salem, Oregon 97302
(800) 854-3140
FAX (503) 363-7885



Inside: Go-Kart Fuel Service Bulletin..