

J&J Amusements, Inc.

33155-A Camino Capistrano / San Juan Capistrano, CA 92675
714/493-4033 800-854-3140 FAX 714/661-2647

SERVICE BULLETIN

April 29, 1993

GO-KART # 3

AFFECTED UNIT- 1993 Black Frame Single and Double Seater GoKarts.

REASON FOR UPDATE- The bolts that hold the steering shaft are working loose resulting in poor handling of the gokart and/or breakage of the bolts.



CORRECTIVE ACTION- Install new steering shaft and hardware. Follow the installation instruction below.

NOTE: Save all old steering shafts. When the retrofit is completed and all old steering shafts are boxed, call Dan at J&J Amusements, 1-800-854-3140.

INSTALLATION OF UPDATED STEERING SHAFT

1. Remove steering wheel (#1) from old steering shaft.
2. Remove steering cover (#18).
3. Remove nuts (#16), then remove tie rod ends (#13) from steering shaft.
4. Remove bolts (#10) and washers (#11 & 12). Next remove old steering shaft.
5. Install the updated steering shaft with the new hardware supplied (See Diagram #2) in the reverse order.

NOTE: USE RED THREAD LOCK ON BOLTS (#10) WHEN INSTALLING.

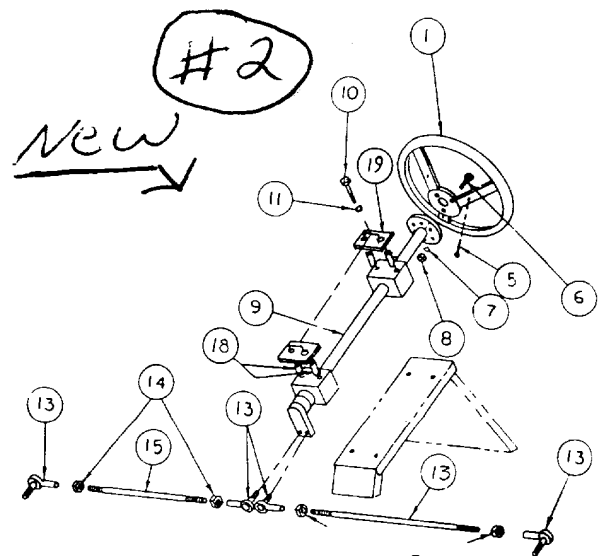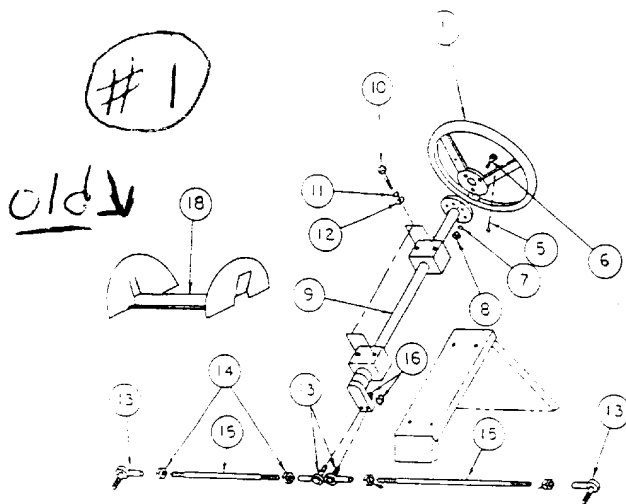

If you have any problems with these instr ————— to give me a call, 1-800-854-3140.